


SHIELDJOINT ARRIS REPAIR

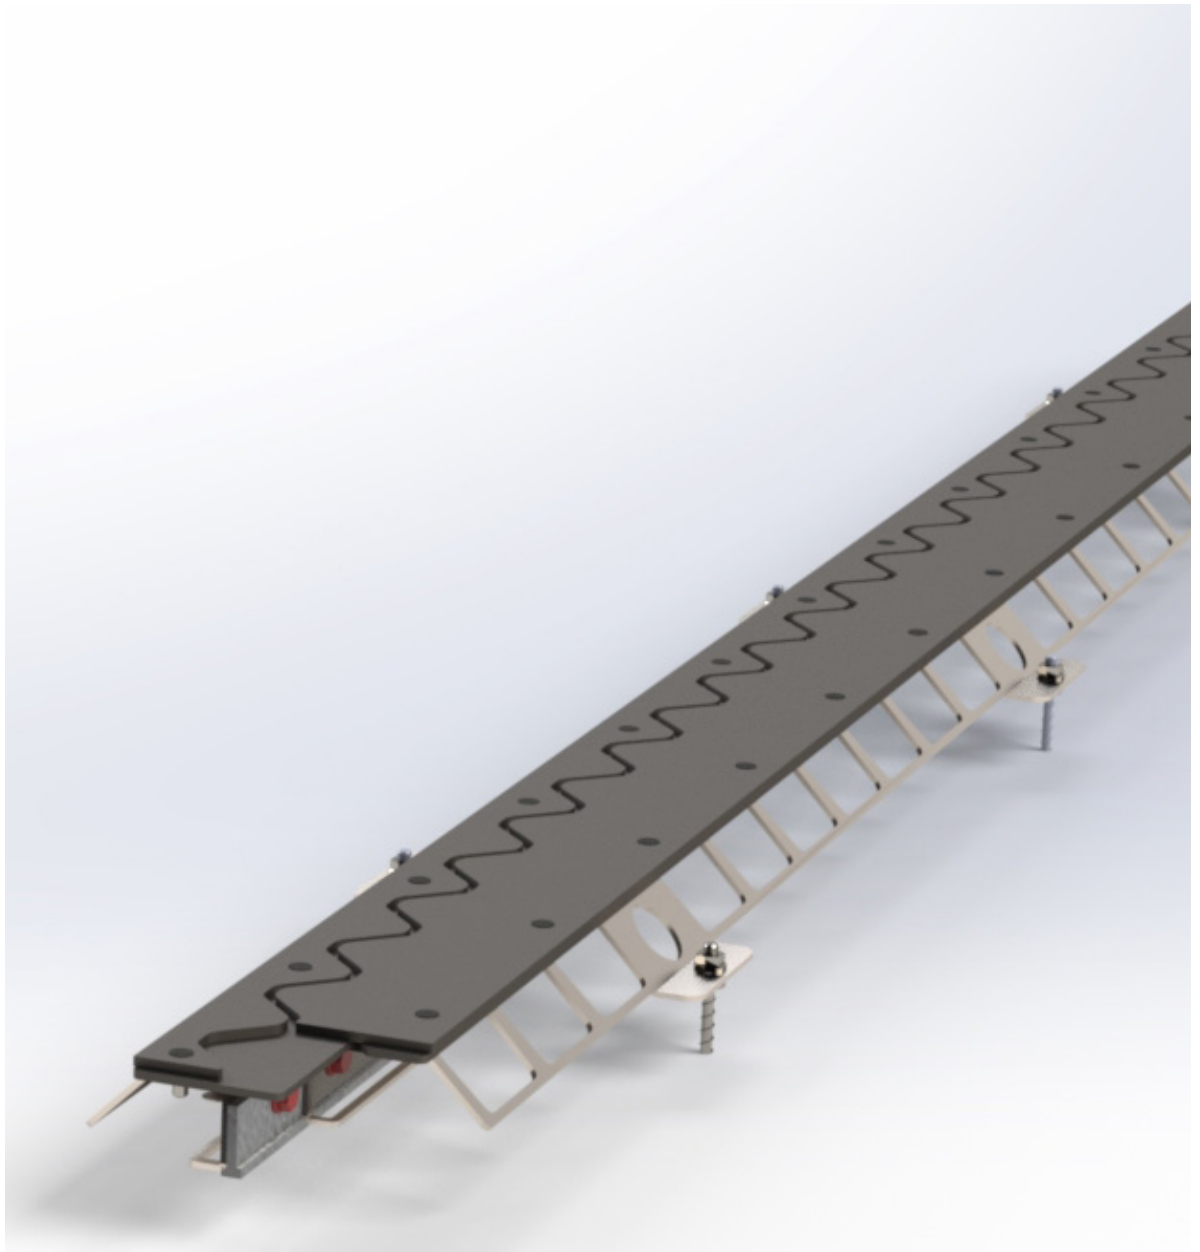

www.isedio.com

Isedio Limited. Unit 10 Jubilee Park, Badger's Cross Lane, Somerton, Somerset, TA11 7JF, UK.
T: +44 (0) 1458 270 600 E: info@isedio.com Registered in England and Wales: 07025519

Copyright © 2020 Isedio Limited. Errors and omissions excepted. Isedio Limited reserves the right to revise this documentation and to make changes in content from time to time without obligation on the part of Isedio Limited to provide notification of such revision or change. Information contained within this document is approximate.

SHIELDJOINT ARRIS REPAIR

PRODUCT DESCRIPTION & USES

SHIELDJOINT ARRIS REPAIR is specifically designed for the repair of construction joints where the concrete either side of the joint has become damaged through traffic impact. Damaged construction joints are typically found in medium to high traffic zones such as racking aisles, access doorways and dock loading areas.

The repair is a simple case of cutting away the damaged concrete on both sides of the joint to a specific width and depth, placing and fixing SHIELDJOINT ARRIS REPAIR with special screw fixings, adjusting to level and filling each side with suitable mortar compound.

Unlike other repair solutions, SHIELDJOINT ARRIS REPAIR does not require the gap between the top plates to be sealed to prevent debris from entering the floor due to its unique design.

The finished installation will ensure materials handling traffic transverses the joint in any direction with no impact to the joint nor the wheeled traffic. This long-term repair solution enables busy logistics centres, warehouses and factories to operate without the further cost of downtime for repeated maintenance.

It is essential to ensure load transfer between the slab panels exists and is sufficient for the application. Typically, slabs requiring repair are fully cured and no further shrinkage is expected. However, SHIELDJOINT ARRIS REPAIR is capable of a joint opening of 25mm if further joint movement is anticipated.


MATERIAL SPECIFICATION

COMPONENT	MATERIAL
TOP PLATES	HOT ROLLED (CAN BE SUPPLIED IN STAINLESS STEEL OR HOT DIP GALVANISED)
FRANGIBLE FASTENER	NYLON
EXPANSION FOAM	10MM THICK MIOTHENE

TECHNICAL DATA

DESCRIPTION	DIMENSION & TOLERANCE
JOINT LENGTH	1950MM +/-2.0MM
STRAIGHTNESS	+/-0.5MM IN 600MM
GENERAL DIMENSIONAL TOLERANCE	DIMENSIONS < 12MM +/-0.5MM DIMENSIONS > 12MM +/-2.0MM


PLAN AND END VIEW IMAGES

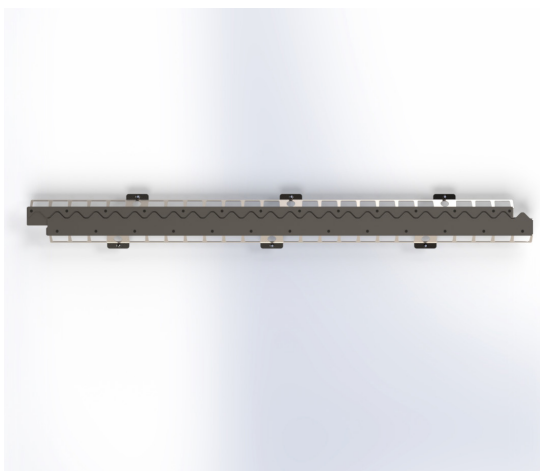

www.isedio.com

Isedio Limited. Unit 10 Jubilee Park, Badger's Cross Lane, Somerton, Somerset, TA11 7JF, UK.
T: +44 (0) 1458 270 600 E: info@isedio.com Registered in England and Wales: 07025519

INSTALLATION

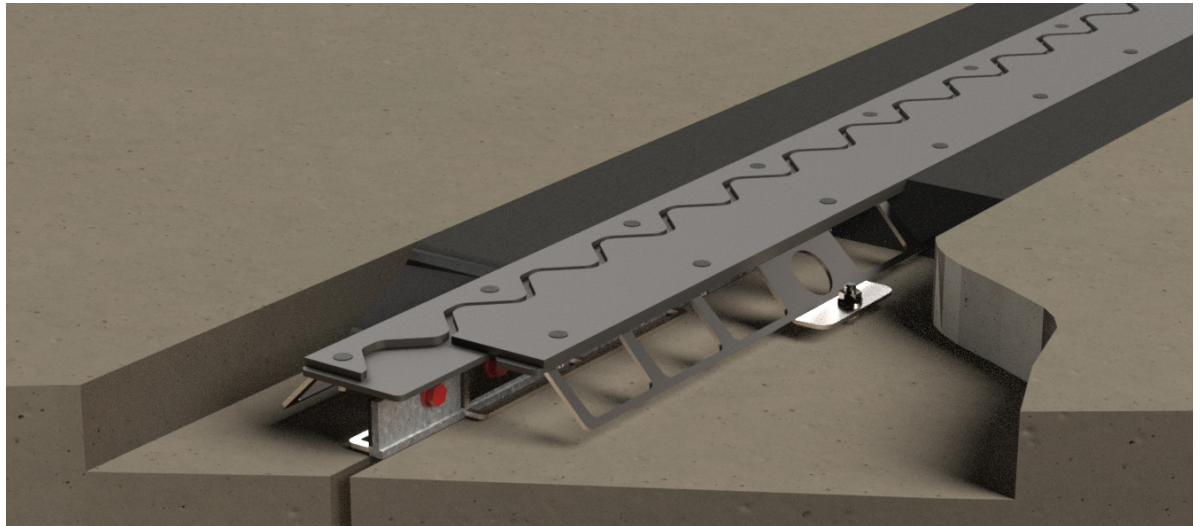

The damaged section of concrete is required to be cut away to 125mm on one side of the joint and 150mm on the other side of the joint, to a consistent depth of 55mm. The floor must be marked out as to where the saw cuts will take place. To make breaking the concrete out a simple task, several saw cuts can be made close to one another, such that the remaining concrete is easily broken out. The bottom of the newly formed channel and its sides must be vacuumed clean to ensure it is free of dust. The prepared area should have straight vertical edges and a clean scabbled base.

A closed cell poly cord material of suitable diameter is pushed flush into the gap between the slab panels at the bottom of the channel. If required mortar primer is applied to the exposed concrete surfaces.

SHIELDJOINT ARRIS REPAIR is lowered in to the channel and positioned. A 6mm masonry drill bit is used to drill a 30mm deep hole into the slab through the fixing lugs on the wings of the joint. The joint is removed and the special self-cutting fixing screws are screwed in to the holes to a depth of 25mm. The joint is replaced on to the fixing screws.

Height adjustment of the joint is made by winding the screw in or out of the concrete. A nut is then fitted over the top of the joint wings to hold the joint in position.

It is recommended to use a magnetic spirit level to ensure the top of the repair joint remains level and flat and is flush with the surrounding concrete. If an 85mm drill hole is too deep for the slab then the fixing can be shortened by cutting to length. It is critical that the nuts are securely tightened and the joint is checked to be flush to the floor prior to casting the mortar. Once the mortar is cast there is no opportunity to adjust the height. Isedio recommend Sib-Eco-Crete self-levelling mortar (www.sibland.pt) or similar product that can be cast in one pour.

Fill the void either side of the joint with mortar until it reaches the finished floor level. The mortar should be finished to provide the required surface finish, normally hand trowel smooth. Continuous checks should be made to ensure the repair system remains level and flush to the concrete surface.

For mortar curing times and post installation trafficking times please refer to the chosen manufacture datasheet.

PACKAGING INFORMATION

SHIELDJOINT ARRIS REPAIR

JOINT (MM)	QTY & METRES OF JOINT PER BUNDLE	APPROX BUNDLE WEIGHT INC PACKAGING (KG)	MAX NO OF BUNDLES & METRES PER TRUCK
75MM	60 OFF - 117M	1595 KG	15 BUNDLES - 1755M

www.isedio.com

Isedio Limited. Unit 10 Jubilee Park, Badger's Cross Lane, Somerton, Somerset, TA11 7JF, UK.
T: +44 (0) 1458 270 600 E: info@isedio.com Registered in England and Wales: 07025519